Nitta Corp. of America
(800) 221-3689
Fax: (770) 623-1398

RT-15NF

www.nitta.com

		TEMPERATURE		PRESS		SKIVE	PULLEY	
SPLICE	**PRESSURE**	(range in deg. F)		**TIME**	**FOIL**	**LENGTH**	**MIN. DIA.**	**ADHESIVE**
(options)	(PSI)	**LOW**	**HIGH**	(min)	(position)	(in)	(in)	
SKIVE	30	250	250	30	-	2.75		NLG KIT
LACING TYPE & SIZE		GATOR # 1						
		ALLIGATOR STAPLE # 62						
RECOMMENDED SPLICE	LACING							
Skive instructions		Apply Polybond E to NBR surface, only, twice. Let dry 5 minutes each time. Apply NLG mix to entire surface, fabric and NBR, twice. Let dry 5 minutes first time, 1 minute second time. Match skived pieces and put in press.						
revised 4-Oct-05								

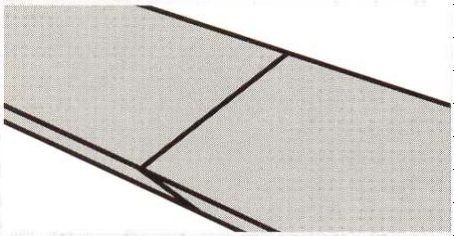

Skive Splice